General Version 1.2

C2H4-S3-3V is a popular small size and costeffective Ethylene sensor module with excellent performance. Rapid detection of Ethylene gas is possible while maintaining high accuracy over a wide temperature range. In addition, NDIR can be used for more than 10 years in a stable state for a long time.

ELT Sensor Data Sheet for C2H4-S3-3V



Features

- Non-Dispersive Infrared (NDIR) Single Channel
 Technology to measure C2H4 levels.
- Excellent compensation of Temperature Effect on C2H4 concentration.
- Output : TTL-UART, I2C, ALARM,
 Analog Voltage or PWM is optional.
- Simple Calibration with Non-Periodic Manual

Calibration (0_MCDL : CAL1) and Periodic

Automatic Calibration (0_ACDL : CAL2).

• Size: 33mmx33mmx13.1mm

• Weight: 10 grams

Specifications

Applications

A Gas alarming detector or equipment of C2H4 gas.

General Performance

Operating Temperature : -20 ~ 50°C

Operating Humidity: 0 ~ 95% RH (Non-condensing), 0 ~ 99% RH (Non-condensing) (1)

Storage Temperature : -30°C ~70°C

Measurement

Sensing Method: NDIR (Non-dispersive Infrared)

Measurement Range: 0 ~ 100% LEL (=0~27,000ppm vol. is optional) (2)

Output Default: % LEL, Optional: ppm (270ppm unit)

Accuracy: ±3% of F.S.^{(3),(4),(5)}

Detection Limit: 2% LEL (=540ppm vol.), **Resolution:** 1% LEL (=270ppm vol.)

Step Response Time (90%, 1/e) : 90 seconds / 45 seconds (Diffusion)

Sampling Interval: 3 seconds

Warming-up Time: < 6 seconds (for Detection), 3 minutes (for Accuracy)

Electrical Data

Power Input: 3.2V ~3.6V(6)

Current Consumption: Normal mode: 12mA, Peak: 190mA, Sleep < 0.3mA

Product Derivatives and Relative Functions (Ordering Models)

Ordering Models					
C2H4-S3	UART,I2C, ALARM, PWM, 0_MCDL(CAL1)/0_ACDL(CAL2)	C2H4-S3-3V			
C2H4-S3 G	Resistant up to 99% Humidity for Application of Agricultural Green House	C2H4-S3 G -3V			

C2H4-S3 has various output TTL-UART, I2C, ALARM while as PWM or Analog voltage is selectable as option. 2.54pitch 13pin side hole connector besides 2mm pitch 10 and 4pin 2 row

⁽¹⁾ C2H4-S3G: 0 ~ 99% RH (Non-condensing) for Industrial Application of Ethylene gas.

⁽²⁾ PPM unit output is selectable as option when you designate on issuing order. (500ppm unit)

^{(3) 2%} should be added for absolute measurements for uncertainty of calibration gas mixture unless '0' ppm or '0'ppm standard gas calibration is done.

⁽⁴⁾ Air pressure is assumed as 101.3 kPa.

⁽⁵⁾ If sensor is affected by the shock, may need field calibration before installation.

⁽⁶⁾ DC Supply should be regulated without ripple < 100mV, low noise power source is needed for best accuracy.

header connectors.

Pin Map with J11&J12 Connectors

J-11	Description
1/3	VDD
2/4	GND

J-12	C2H4-S3-3V C2H4-S3-3V (Analog Voltage Op								
1	TTL RXD (← CPU	TTL RXD (← CPU of Master Board)							
2	TTL TXD ($ ightarrow$ CPU	of Master Board)							
3	I2C SCL								
4	I2C SDA								
5	GND								
6	Reserved	Analog Voltage Output (0.5~4.5V)							
7	CAL2-pin: 0_ACDL (for every 7 days ACDL with periodic C2H4-'0'ppm circumstance)								
8	Reserved								
9	CAL1-pin: 0_MCDL (for 10 minutes MCDL with C2H4-'0'ppm- N2-based-gas or Fresh Air)								
10	Reset (Low Active)								

UART 38,400BPS, 8bit, No parity, 1 stop bit

9,600 or 19,200 BPS can selectable through command sets or EK-100SL.

I2C Slave mode only, Internal pull up resister $10k\Omega$

TTL Level Voltage : $0 \le V_{IL} \le 0.4$, $2 \le V_{IH} \le V_{DD}$, $0 \le V_{OL} \le 0.4$, $2.4 \le V_{OH} \le V_{DD}$ (Volt)

ALARM: Open Collector type.

ex) Alarm_On: 25% LEL, Alarm-Off: 10% LEL

Analog Voltage: 0.5~3V (option)


PWM (option)

 t_H = 2 msec(Start) + 1,000 msec x (Measurement_(ppm)/ Range_(ppm)), T_L = 2,000 ms - t_H ,

Pin Map with J13 Connectors


J-13	C2H4-S3-3V	C2H4-S3-3V (PWM/Analog Voltage Option)							
1	Reserved	Analog Voltage Output (0.5~3V)							
2	Alarm (Ope	en Collector)							
3	G	ND							
4	V	VDD							
5	TTL TXD (→ CPU	TTL TXD (\rightarrow CPU of Master Board)							
6	TTL RXD (← CPU	TTL RXD (← CPU of Master Board)							
7	Reserved	PWM Output (TTL)							
8	I2C	I2C SCL							
9	I2C	I2C SDA							
10	Reset (L	Reset (Low Active)							
11	CAL2-pin (for every 7 days ACDL wit	CAL2-pin (for every 7 days ACDL with periodic C2H4-'0'ppm circumstance)							
12	Res	Reserved							
13	CAL1-pin (for 10 minutes MCDL with C	CAL1-pin (for 10 minutes MCDL with C2H4-'0'ppm-N2-based-gas or Fresh Air)							

Dimensions (unit:mm)

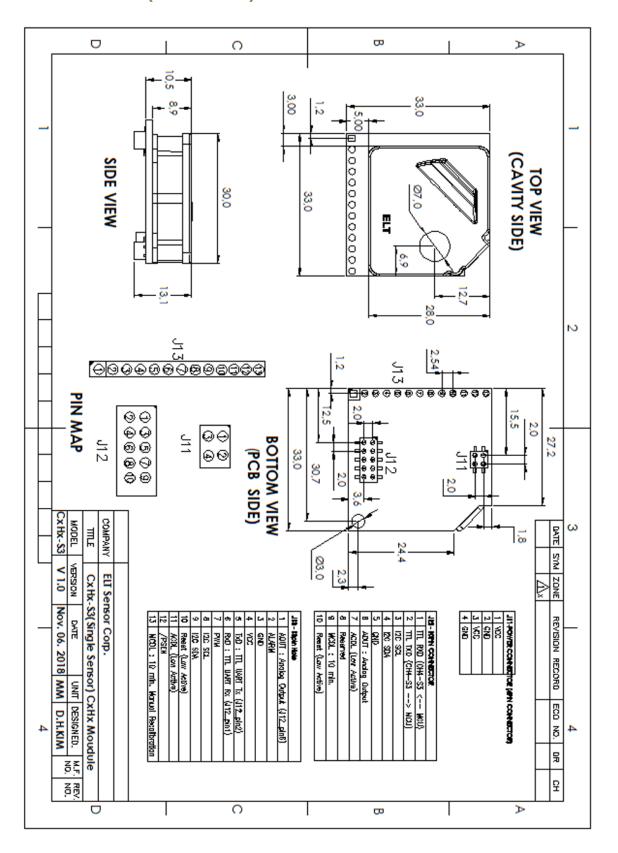


0_MCDL (2 minutes Manual Calibration)

'0' ppm Manual Calibration can be done by giving start command or low signal to CAL1-pin at least more than 10 minutes since the fresh air is fully balanced near sensor.

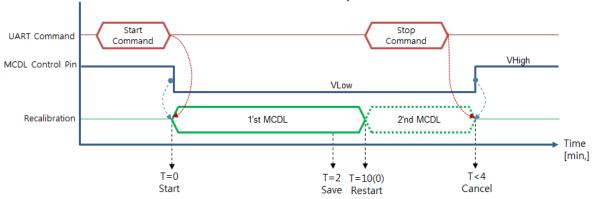

0_ACDL (Periodic Automatic Calibration)

'0' ppm Periodic Automatic Calibration can be used by giving start command or low signal to CAL2-pin. The sensor calibrate automatically first in 2 days, seconds 5 days and every week. '0'ppm Standard Gas can be used when the place doesn't face free air during the period.

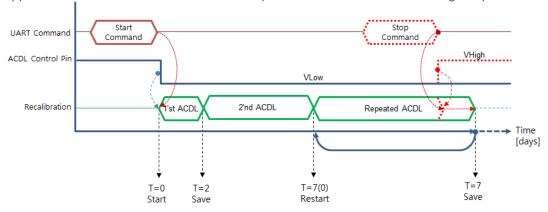

- Method 1. UART Command Set; J12: pin-1 (UART-RX) and pin-2 (UART-TX) to Main-Board (J13: pin-5 and pin-6 are available as well.).
- Method 2. I2C Command Set; J12: pin-3 (SCL) and pin-4 (SDA) to Main-Board. (J13: pin-8 and pin-9 are available as well.)
- Method 3. Let Sensor install on Jig Board, **TRB-100ST (Test and Recalibration Board)** with ambient air-flow condition or with 0'ppm Standard Gas and execute by moving jumper following Manual on the website.

Method 4. Send string command set below to RXD-pin of Sensor on Emulation program. **EK-100SL (Evaluation kit, with Emulation program 'ELTWSD')** is available

Method 5. CAL1 / CAL2-pin settings for 0_MCDL / 0_ACDL

CAL1 0_MCDL	CAL 2 0 ACDL	Function	Process			
0_IVICUL	0_ NCDL		Let C2H4-S3 sensor be located at ambient place			
Low	High	H/W '0'ppm	where no Ethylene gas exist and wait 2 minute.			
		MCDL	'0'ppm Standard gas can be used when '0'ppm is			
			not guaranteed.			
High	Low	H/W '0' ppm	Automatic Calibration can be used where C2H4			
9	ACDL		meet the clear air more than 3 minutes per week.			
⊎igh	⊔iah	Normal	Operate with Factory Calibrated or previously set			
High	High	inoittiai	status			

- X 1. CAL-1pin and CAL-2pin shouldn't have 'Low' at the same time.
 - 2. Be sure to escape MCDL fetch loop between 2 minutes and 4minutes to avoid inappropriate calibration.

Output Descriptions

UART Descriptions

Data Format

SP	SP	SP	D2	D1	'%'	SP	'L'	'E'	'L'	CR	LF
		SP x	3				Sp	ace: (0x20		
		D2 ~	D1			2 by	rte C2	H4 de	ensity	string	
	%						% : 0x25				
	SP						Space: 0x20				
	'LEL'						′ 1	_EL′ s	tring		
	CR						Carriage return : 0x0D				
	LF						Line	feed	: 0x0A		

Above 12byte consist by 2 byte hexadecimal digits, <SP>,<SP>,<SP>, D2, D1, 0x25, <SP>, 'L', 'E', 'L', <CR><LF>, where decimal '0' (corresponds to hexadecimal digit '0x30') is replaced by space (corresponds to hexadecimal digit '0x20'),

EX) 10% LEL (= 2,700 ppm) string is '0x20 0x20 0x20 0x31 0x20 0x25 0x20 0x4C 0x45 0x4C, 0x0D

0x0A',, of which display on the screen is '____10%_LEL<CR><LF>'.

'ppm' display is Option on sale, which D6~D1 string display the C2H4 concentration of

D6	D5	D4	D3	D2	D1	SP	'p'	'p'	'm'	CR	LF
----	----	----	----	----	----	----	-----	-----	-----	----	----

EX) 2,700 ppm string is $'0x20\ 0x32\ 0x37\ 0x30\ 0x30\ 0x20\ 0x70\ 0x70\ 0x6D\ 0x0D\ 0x0A',$ of which display on the screen is $'_2700_ppm<CR><LF>'.$

I2C Communication (Only Slave Mode Operation)

Internal pull up resister $10k\Omega$


Slave Address: 0x31, Slave Address Byte: Slave Address(0x31) 7 Bit + R/W 1 Bit

Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
0	1	1	0	0	0	1	R/W Bit

R/W Bit: Read = 1/Write = 0

When reading the data, Slave Address Byte is 0x63, When writing the data, Slave Address Byte is 0x62.

Block Diagram

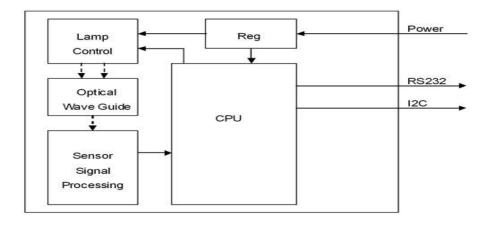

Transmission Sequence in Master

- 1) I2C Start Condition
- 2) Write Command(Slave Address + R/W Bit(0) = 0x62) Transmission and Check Acknowledge
- 3) Write Command(ASCII 'R': 0x52) Transmission and Check Acknowledge
- 4) I2C Stop Command
- 5) I2C Start Command
- 6) Read Command(Slave Address + R/W Bit(1) = 0x63) Transmission and Check Acknowledge
- 7) Read 7 Byte Receiving Data from Module and Send Acknowledge (Delay at least 1ms for reading each byte)

-	Header	C2H4	reserved	reserved	Reserved	reserved					
	1 Byte	2 Byte	0x00	0x00	0x00	0x00					
0 (0 0 0	1 0 0	0								

In need of detail protocol specification and time sequence, 'I2C programming guide' could be provided by contacting Sales Rep.

Alarm Descriptions


Alarm signal operates as Open Collector type and send TTL on signal since C2H4 measured value beyond 25% LEL until it go down to 10% LEL. It is designed to be activated when C2H4 measured value surpass 25% LEL and deactivated down to 10% LEL to avoid unwanted rapid switching by hysteresis effect.

Alarm_On: 25% LEL, Alarm-Off: 10% LEL

EK-100SL series is available for customer to enable to change alarm activation & deactivation point.

PWM Descriptions: Option

- * Measurement_(ppm) = (t_H-2msec)/1000msec x Range_(ppm) (t_H: High Pulse Width)
- * Range_(ppm): 0~100% LEL (0~27,000 ppm)

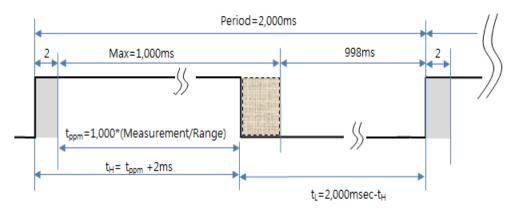

EX) t_H (High Pulse Width) calculation for 50% LEL in 100% LEL Range.

*Measurement(% LEL) = 50% LEL = $(t_H-2ms)/2,000msec \ x \ Range(% LEL)$,

*t_H= 1,000 msec * (50% LEL / 100% LEL) + 2msec = 502msec


(cf: T_L = Period - t_H = 2,000 msec - 502 msec = 1,498 msec.)


Analog Voltage Output Descriptions: Option

Measured Voltage 0.5V~4.5V match proportionally to 0 ~ 100% LEL.

* C2H4 Measurement (ppm) = ((Output voltage-0.5) / (4.5 - 0.5) voltage) x 100% LEL.

EX) if the Output $_{Voltage}$ is 2.5V in 0~100% LEL range, C2H4 (% LEL) = (2.5 - 0.5) V÷ (4.5 - 0.5)V x 100% LEL = 0.5 x 100% LEL = 50% LEL

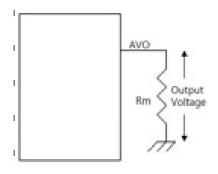

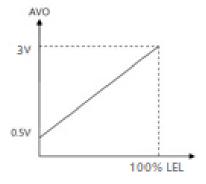

X Caution

- 1. The gold cavity part of the sensor module or the PCB outer part should not touch by the customer's case housing. It causes long-term value fluctuation. Be at least 3 mm apart from the housing.
- 2. When removing and inserting the sensor module, do not hold the gold cavity but hold the PCB on both sides. Put on the electret gloves to prevent the static electricity. (Excessive force on the gold cavity can affect the initial performance and accuracy of the sensor.)
- → If the measured value is wrong, you can calibrate zero point for more than 10 minutes at CAL1 (MCDL) position and use it with high accuracy.
- 3. Do not let water get on, drop, or shock the sensor.
- 4. Do not store the sensors in high temperature and high humidity for long time without applying power. The initial measurement accuracy of the sensor may be affected.
- 5. Be careful not to be affected by static electricity and induction electromagnetic field around sensor.
 - To prevent static electricity from being generated during assembly, wear electrostatic gloves and work on a static-free workbench. (Keep the sensor in the place where the electricity is removed.)
- 6. Install the sensor at a position as far away as possible from the motor or vibration. Vibration or noise may be accuracy affected during sensor operation.
- 7. When using the sensor for the first time or after long term storage, you can use CAL1 MCDL zero point calibration and use it with high accuracy.
- X Specification of CxHy Series could be changed without notice.