AQ7SO2 SENSOR

Sulfur Dioxide (SO₂) Gas Sensor

DOCUMENT PURPOSE

The purpose of this document is to present the performance specification of the AQ7 Series AQ7SO2 Sulfur Dioxide Gas Sensor.

This document should be used in conjunction with the AQ7SO2 Characterization Note and the Product Safety Datasheet (PSDS 2). For guidance on the safe use of the sensor, please refer to the Characterization Note.

The data provided in this document is based on the assumption that the sensor is used at 20°C , 50°RH and 1013°mBar for three months from the date of sensor manufacture.



Sensor Part Number: ADQ702-400

APPLICATIONS

The AQ7 Series are for environmental applications; other applications, including industrial safety, may not be suitable.

FEATURES AND BENEFITS



High resolution



Low detection limit



High correlation with control station



Individual compensation for temperature and cross sensitivity




AQ7SO2 Sulfur Dioxide Gas Sensor

TECHNICAL OPERIFICATIONS				
TECHNICAL SPECIFICATIONS MEASUREMENT				
Technology	4-electrode electrochemical			
Measurement Range	0 ppm SO ₂ to 1 ppm SO ₂			
Maximum Overload	5 ppm SO ₂			
Onboard Filter	none			
Sensitivity*	1200 nA/ppm ±300 nA/ppm			
Response Time (T ₉₀)	≤ 60 seconds			
Resolution* (when using recommended electronics)	2 ppb			
Baseline Offset*	<±200 nA			
Repeatability*	< ±5 % of signal			
Linearity**	linear			
Low Detection Limit*	5 ppb			
ELECTRICAL				
Recommended Load Resistor	68 Ω			
Sensor Bias Voltage	O mV			
MECHANICAL				
Weight	9 g			
Outer Plastic Body Material	ABS			
Contact Material	copper with gold coating			
Contact Material Orientation Sensitivity	copper with gold coating none			
Orientation Sensitivity				
Orientation Sensitivity ENVIRONMENTAL Operating	none			
Orientation Sensitivity ENVIRONMENTAL Operating Temperature Range Operating Humidity	none -30°C to 50°C (55°C intermittent***)			
Orientation Sensitivity ENVIRONMENTAL Operating Temperature Range Operating Humidity Range Recommeneded	none -30°C to 50°C (55°C intermittent***) 15 %RH to 90 %RH non-condensing			
Orientation Sensitivity ENVIRONMENTAL Operating Temperature Range Operating Humidity Range Recommeneded Storage Temperature	none -30°C to 50°C (55°C intermittent***) 15 %RH to 90 %RH non-condensing 0°C to 20° in original sealed container			
Orientation Sensitivity ENVIRONMENTAL Operating Temperature Range Operating Humidity Range Recommended Storage Temperature Typical Applications	none -30°C to 50°C (55°C intermittent***) 15 %RH to 90 %RH non-condensing 0°C to 20° in original sealed container			
Orientation Sensitivity ENVIRONMENTAL Operating Temperature Range Operating Humidity Range Recommeneded Storage Temperature Typical Applications LIFETIME	none -30°C to 50°C (55°C intermittent***) 15 %RH to 90 %RH non-condensing 0°C to 20° in original sealed container ambient environmental monitoring			
Orientation Sensitivity ENVIRONMENTAL Operating Temperature Range Operating Humidity Range Recommeneded Storage Temperature Typical Applications LIFETIME Storage Life Long-Term Sensitivity	none -30°C to 50°C (55°C intermittent***) 15 %RH to 90 %RH non-condensing 0°C to 20° in original sealed container ambient environmental monitoring 6 months in original sealed container			

^{*}Specifications are based on measurements made with cylinder gases using a flow rate of 500 ml/min and are valid at 20°C, 50 %RH and 1013 mBar using Honeywell recommended circuitry. Performance characteristics outline the $performance\ of\ sensors\ supplied\ within\ the\ first\ three\ months.\ Output\ signal\ can$ drift below the lower limit over time.

Product Dimensions

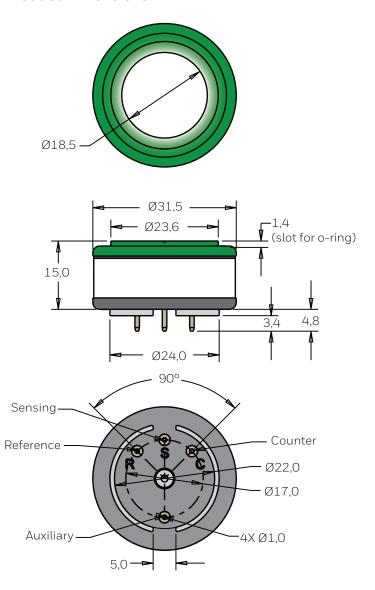

Dimensions mm All tolerances $\pm 0,15$ mm unless otherwise stated

 $^{^{\}star\star}$ Linear through the concentration range across the whole operational environment range.

^{***} Can be operated at 55° C for two hours (within the operating humidity range).

AQ7SQ2 Sulfur Dioxide Gas Sensor

Poisoning

Gas sensors are designed for operation in a wide range of environments and harsh conditions. However, it is important that exposure to high concentrations of solvent vapors is avoided, during storage, fitting into instruments, and operation.

When using sensors with printed circuit boards (PCBs), degreasing agents should be used before the sensor is fitted.

Do not glue directly on or near the sensor as the solvent may cause crazing of the plastic.

Cross Sensitivity Table

Whilst AQ7 Series gas sensors are designed to be highly specific to the gas they are intended to measure, they will still respond to some degree to various other gases. The table below is not exclusive and other gases not included in the table may still cause a sensor to react.

IMPORTANT NOTE: The cross sensitivity data shown below does not form part of the product specification and is supplied for guidance only. Values quoted are based on tests conducted on a small number of sensors and any batch may show significant variation. For the most accurate measurements, an instrument should be calibrated using the gas under investigation.

Gas	Gas Concentration	Cross Interference
Carbon Monoxide (CO)	5 ppm	0 %
Nitrogen Dioxide (NO ₂)	400 ppb	120 %
Hydrogen Sulfide (H ₂ S)	1 ppm	150 %
Ozone (O ₃)	400 ppb	40 %
Isobutylene (C ₄ H ₈)	5 ppm	0 %

WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgment or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.

⚠ WARNINGMISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only.
 Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

SAFETY NOTE

This sensor is designed to be used in environmental applications. To ensure that the sensor and/or instrument in which it is used, are operating properly, it is a requirement that the function of the device is confirmed by exposure to target gas (bump check) before each use of the sensor and/or instrument. Failure to carry out such tests may jeopardize the safety of people and property.

FOR MORE INFORMATION

Honeywell Advanced Sensing
Technologies services its customers
through a worldwide network of sales
offices and distributors. For application
assistance, current specifications, pricing
or the nearest Authorized Distributor, visit
our website or call:

USA/Canada +1 302 613 4491 Latin America +1 305 805 8188 Europe +44 1344 238258 Japan +81 (0) 3-6730-7152 Singapore +65 6355 2828 Greater China +86 4006396841

Honeywell

Advanced Sensing Technologies

830 East Arapaho Road Richardson, TX 75081 sps.honeywell.com/ast

